



SSER /SSEL

□□ER

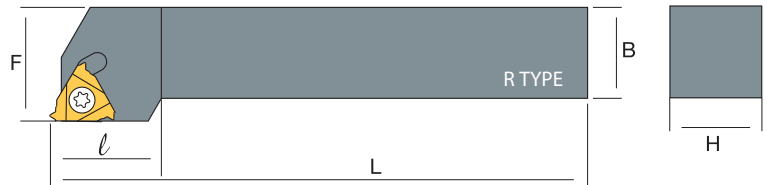

TURNING

GROOVING

THREADING

MILLING

DRILLING

ENDMILLS

DRILLS

SPARE PARTS





INDEX







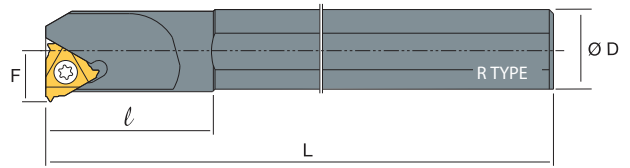

	DESCRIPTION			STOCK		DIMENSIONS								
				R	L	H	B	L	F					
11ER-□□	SSER/L	0808	E11	●	●	08	08	70	11	-	-	-	ST-SC0257	ST-WRT07
		1010	E11	●	●	10	10	70	11	-	-	-	ST-SC0257	ST-WRT07
		1212	F11	●	●	12	12	80	12	-	-	-	ST-SC0257	ST-WRT07
		1616	H11	●	●	16	16	100	16	-	-	-	ST-SC0257	ST-WRT07
16ER-□□	SSER/L	1616	H16	●	●	16	16	100	16	ST-SHE16	ST-SC5011	ST-WR0030	ST-SC3514	ST-WRT15
		2020	K16	●	●	20	20	125	20	ST-SHE16	ST-SC5011	ST-WR0030	ST-SC3514	ST-WRT15
		2525	M16	●	●	25	25	150	25	ST-SHE16	ST-SC5011	ST-WR0030	ST-SC3514	ST-WRT15
		3232	P16	●	●	32	32	170	32	ST-SHE16	ST-SC5011	ST-WR0030	ST-SC3514	ST-WRT15
22ER-□□	SSER/L	2525	M22	●	●	25	25	150	25	ST-SHE22	ST-SC6011	ST-WR0040	ST-SC0416	ST-WRT15
		3232	P22	●	●	32	32	170	32	ST-SHE22	ST-SC6011	ST-WR0040	ST-SC0416	ST-WRT15
		4040	S22	●	●	40	40	250	40	ST-SHE22	ST-SC6011	ST-WR0040	ST-SC0416	ST-WRT15

SSIR / SSIL

screw on

IR



	DESCRIPTION			STOCK		DIMENSIONS				 R  ←  ←  ← 			 ← 	
				R	L	D	d	L	F					
08IR-□□	S16M07	SSIR/L	08	●	●	16	7,8	150	5,3	-	-	-	ST-SC0226	ST-WRT07
11IR-□□	S10K	SSIR/L	11	●	●	10	12	125	7,4	-	-	-	ST-SC0257	ST-WRT08
	S12K		11	●	●	12	16	125	8,4	-	-	-	ST-SC0257	ST-WRT08
	S16M10		11	●	●	16	12	150	7,4	-	-	-	ST-SC0257	ST-WRT08
	S16Q		11	●	●	16	20	180	8,9	-	-	-	ST-SC0257	ST-WRT08
16ER-□□	S16Q	SSIR/L	16	●	●	16	16	180	10,2	-	-	-	ST-SC3511	ST-WRT15
	S20R		16	●	●	20	24	200	13,7	-	-	-	ST-SC3511	ST-WRT15
	S25S		16	●	●	25	29	250	16,2	ST-SHE16	ST-SC5011	ST-WR0030	ST-SC3514	ST-WRT15
	S32T		16	●	●	32	36	300	19,7	ST-SHE16	ST-SC5011	ST-WR0030	ST-SC3514	ST-WRT15
	S40V		16	●	●	40	44	350	23,7	ST-SHE16	ST-SC5011	ST-WR0030	ST-SC3514	ST-WRT15
22ER-□□	S20R	SSIR/L	22	●	●	20	24	200	14	ST-SHE22	ST-SC6011	ST-WR0040	ST-SC0411	ST-WRT15
	S25S		22	●	●	25	29	250	18,1	ST-SHE22	ST-SC6011	ST-WR0040	ST-SC0411	ST-WRT15
	S32T		22	●	●	32	38	300	21,6	ST-SHE22	ST-SC6011	ST-WR0040	ST-SC0411	ST-WRT15
	S40V		22	●	●	40	46	350	25,6	ST-SHE22	ST-SC6011	ST-WR0040	ST-SC0411	ST-WRT15
	S50W		22	●	●	50	63	400	35,6	ST-SHE22	ST-SC6011	ST-WR0040	ST-SC0411	ST-WRT15

TURNING

GROOVING

THREADING

MILLING

DRILLING

ENDMILLS

DRILLS

SPARE PARTS

INDEX

TURNING

GROOVING

THREADING

MILLING

DRILLING

ENDMILLS



DRILLS

SPARE PARTS

INDEX

SSER-VS


□□VER

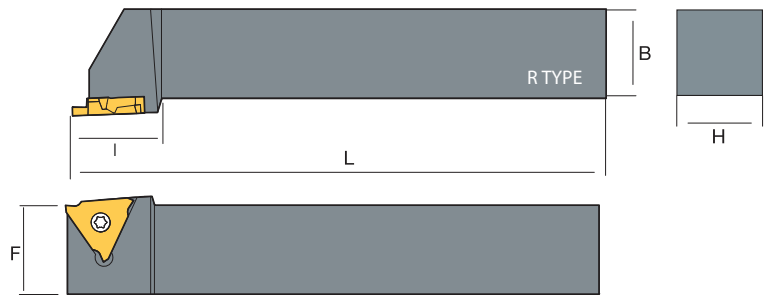


VER□□	DESCRIPTION			STOCK		DIMENSIONS								
				R	L	H	B	L	F					
VER11-□□	SSER/L	0808	F11VS	●		08	08	80	08	ST-SC0257	ST-WRT07			
		1010	F11VS	●		10	10	80	10	ST-SC0257	ST-WRT07			
		1212	F11VS	●		12	12	80	12	ST-SC0257	ST-WRT07			
		1616	H11VS	●		16	16	100	16	ST-SC0257	ST-WRT07			
VER16-□□	SSER/L	1010	F16VS	●		10	10	80	10	ST-SC3514	ST-WRT15			
		1212	F16VS	●		12	12	80	12	ST-SC3514	ST-WRT15			
		1616	H16VS	●		16	16	100	16	ST-SC3514	ST-WRT15			
		2020	K16VS	●		20	20	125	20	ST-SC3514	ST-WRT15			
		2525	M16VS	●		25	25	150	25	ST-SC3514	ST-WRT15			
		3232	P16VS	●		32	32	170	32	ST-SC3514	ST-WRT15			
		4040	R16VS	●		40	40	250	40	ST-SC3514	ST-WRT15			
VER22-□□	SSER/L	2525	M22VS	●		25	25	150	25	ST-SC0416	ST-WRT15			
		3232	P22VS	●		32	32	170	32	ST-SC0416	ST-WRT15			
		4040	R22VS	●		40	40	250	40	ST-SC0416	ST-WRT15			

MSSR

SR□□

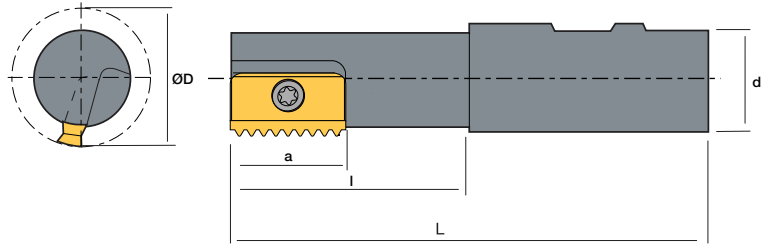

SR□□	DESCRIPTION		STOCK	DIMENSIONS									
				D	Z	d	L	l	a				
SR14-□□	MSSR	14-100-14-20-1T	●	14	1	20	100	25	14	ST-SC0256	ST-WRT08		
SR21-□□	MSSR	18-100-21-20-1T	●	18	1	20	100	30	21	ST-SC0409	ST-WRT15		
		25-125-21-20-1T	●	25	1	20	125	30	21	ST-SC0411	ST-WRT15		
		28-090-21-25-1T	●	28	1	25	90	30	21	ST-SC0411	ST-WRT15		
		38-120-21-32-3T	●	38	3	32	120	30	21	ST-SC0411	ST-WRT15		
		43-090-21-32-3T	●	43	3	32	90	30	21	ST-SC0411	ST-WRT15		
SR30-□□	MSSR	29-150-30-25-1T	●	29	1	25	150	50	30	ST-SC0514	ST-WRT20		

TURNING

GROOVING

THREADING

MILLING

DRILLING

ENDMILLS

DRILLS

SPARE PARTS

INDEX